

If your bill validator is blinking 2X, your coin mech probably needs this tuning procedure done.

1. Turn off power to PLC (pull PLC fuse or turn off control board breaker).
2. Clean coin path in flight deck with a damp cloth.
3. Lower acceptor part of changer (flight deck).
4. Locate small square hole below price switch
5. Insert a small screwdriver into hole.
6. Twist the screwdriver, slightly, to short the two pins
7. Turn on power to PLC (while still shorting the two pins).
8. Remove screwdriver.
9. Insert 2 nickels. They will not be accepted
10. Insert 2 dimes. They will not be accepted.
11. Insert 2 quarters. They will not be accepted.
12. Press down on the return lever two times.

Coin mech should dispense 1 nickel, meaning it is properly returned.